WHAT COMES IN THE STRUCTURAL EPOXY INJECTION RESIN KIT



KIT INCLUDES

- •(1) Tube of Structural Epoxy Injection Resin
- •Gloves and Instructions
- •(1) Tube of High Strength Anchoring Epoxy Paste •(10) Ports
- •(2) Static epoxy mixing nozzles

30 FOOT KITS HAVE 3 TIMES THE AMOUNT IN THAT KIT

PRODUCTS COMMONLY USED WITH CRACK REPAIR







Rhino Carbon Fiber™ Concrete Crack Lock™ stitches



RCF™ High Strength Anchoring Epoxy Paste

RECOMMENDED POWER TOOLS

(TOOLS MAY VARY DEPENDING ON PROJECT)

5-Inch Surface Grinding **Dust Shroud Kit**



Use for grinding foundation wall **USE DIAMOND TIP WHEEL

10-Gallon Dust Extractor



Collects dust while attached to grinder and shroud tools

Tuck Point Grinder with Dust Shroud Attachmentl



Use to tuckpoint the wall **USE DIAMOND EDGE BLADE

Hammer Drill



Use for concrete removal **USE CHISEL OR SPADE TIP ATTACHMENT

YOU WILL ALSO NEED...

- Safety Goggles
- Marker
- Respirator Mask
- Hammer
- Hard Hat
- •Epoxy Gun
- Coveralls
- •Wire Brush
- Drop Cloth/ Plastic

SAFETY WARNINGS

Please read and follow safety procedures for all tools and wear proper safety equipment during installation.

While using power tools, follow all EPA/OSHA guidelines for lead paint removal and respiratory protection. For more information visit www.epa.gov or www.osha.gov.



1-888-684-3889 | www.RhinoCarbonFiber.com



© All Rights Reserved

RCF™ STRUCTURAL EPOXY INJECTION RESIN KIT INSTRUCTIONS

Revision Date 06/16/2021

8383 Riley Street, Zeeland, MI USA 49464 P: +1 888 684 3889 E: info@rhinocarbonfiber.com

PLEASE READ ALL DIRECTIONS CAREFULLY & WEAR SAFETY GOGGLES BEFORE INSTALLING



)1 PREP

- •Examine the crack that is being repaired
- •Mark any areas that the crack is not continuous
- •Lay plastic, drop cloth or cardboard down on floor
- •Clean the crack and immediate surrounding areas with a wire brush

Tools: Marker, wire brush, plastic, drop cloth or cardboard



02 PORT LOCATIONS

CONTINUOUS CRACKS:

•Mark port locations approximately every 18" starting from the bottom of the crack

DISCONTINUOUS CRACKS:

- •Mark port locations just above any discontinuous point in the crack
- •Space the remaining ports every 18" from the discontinuous locations

Note: Additional ports may be required for cracks with multiple discontinuous locations

Tools: marker and measuring tape



PORT INSTALLATION

- •Detach port cap from the side of the port and set aside
- •Dispense a small amount of Rhino High Strength Epoxy Paste onto a disposable work surface such as cardboard or painters tray
- •Roll the entire flat edge of the port in the Rhino High Strength Epoxy Paste
- •Make sure the hole for the port is not plugged with epoxy
- •Pressing firmly place the port directly over the crack at previously marked locations

Tools: gloves, disposable work surface, ports



01: Roll port edge in High Strength Anchoring Epoxy Paste



02: Press port firmly directly over crack



03: Cover over previously market locations



1-888-684-3889 | www.RhinoCarbonFiber.com

© All Rights Reserved



04 COVERING THE CRACK

- •Dispense approximately 1/3 of the tube of the High Strength Anchoring Epoxy Paste onto the disposable work surface (like card board). Add more as needed.
- •Apply the High Strength Anchoring Epoxy Paste over the entire crack
- •Feather the epoxy approximately 2", or more, on both sides of the crack
- •At port locations, apply the epoxy around the entire port until the port base is no longer visible

Tools: Gloves, disposable work surface, spatula







05 INJECTION

- •On the epoxy gun, swap the black plastic pull tab, located on the back of the epoxy gun with one of the plastic pushers (Reference epoxy gun instruction manual)
- •Place the Structural Epoxy Injection Resin with the static mixing nozzle into the epoxy gun
- •Starting at the bottom port, push the static mixer into the port until you feel a click
- •Dispense resin until you see the resin coming out of the port located directly above
- •Remove the epoxy gun and push the cap into the port
- •Move to the next port and repeat the process until you have worked all the way up the wall

Tools: Gloves, port caps

06 CLEAN UP (optional)

•Once the epoxy and resin have cured, remove the ports from the wall using a hammer

Tools: Hammer



1-888-684-3889 | www.RhinoCarbonFiber.com